

MONUMENT RECORD
State of Indiana - County of Monroe

Section: 20

Township: 7 North

Range: 1 East



Corner ID: Polk G-13

Monument Description & Remarks: 3" with aluminum cap stamped, "LS20200079 (2004)".
Survey Sign 4ft above ground at pt. B

References On File: Matthew Cooper survey, USDA (2005) on file in Records Office
cabinet S, envelope 285

RECOVERY TIE DRAWING
Field Book 38 Page No. 72


A - 3" Monument
B - S 19° W 14.25' to Survey
Sign in 22" Red Oak
C - N 44° W 12.68' to Sign
in 4" Sugar Maple
D - N 62° E 39.40' to Sign
in 5" Sugar Maple
E - S 14° W 34.74' to Sign
in 12" Pignut Hickory

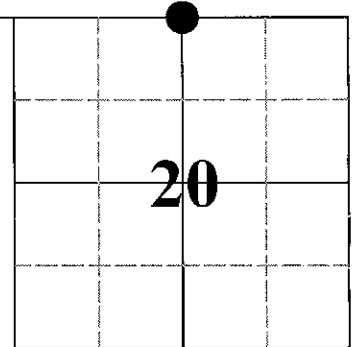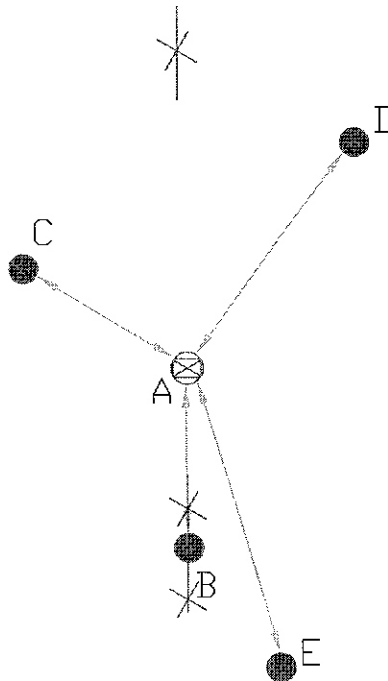

Not To Scale
Compass Bearing Magnetic North


I, Kevin P. Enright, Monroe County Surveyor, hereby certify that this document was prepared under my direction in accordance with the provisions of Section 12-11 of the Indiana Code; and the above data is given under my hand and seal this 8th day of January, 2007.

Kevin P. Enright

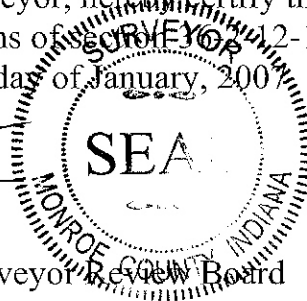

Administered by the Monroe County Surveyor Review Board

Date: 2/20/2007 DB

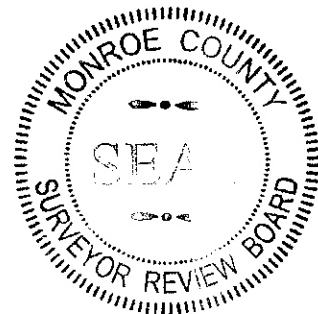

Index: N07

Corner: N1/4 S20

LAND CORNER RECORD

State of Indiana
Hoosier National Forest

POLK 913

Township: 7N

Range: 1E


Section: 20 2nd P.M.

County: MONROE CO.


EXISTING SURVEYS

Original Government Survey				Original Survey Evidence Found			
Year Surveyed:	1814	By:	Author Henrie	Date of Search:		By:	
Original Monument:	Post			Monument Found:			
Species	Diameter	Bearing	Distance	Species	Diameter	Bearing	Distance
Hickory	4"	N17°W	3 Lks				
Ash	10"	S61°E	13 Lks				
Subsequent Corner Restoration				Evidence of Subsequent Corner Restoration Found			
Where Filed or Recorded:	Recorders Office			Year	1906	By:	CM Bower
Book: S.Bk.2	Page: 183	Date: 1871		Searched:			
Monument Set:	Not Indicated			Monument Found	Not Indicated		
Species	Diameter	Bearing	Distance	Species	Diameter	Bearing	Distance

OTHER EVIDENCE

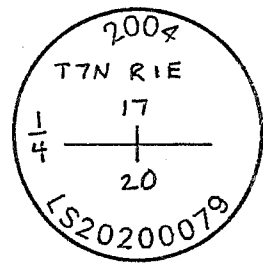Describe corner loc. relative to nearby features & dir. to corner location; note fences, roads, etc.	Sketch of Monument
The monument is located on a southeast facing slope, about 150' southeast of a ridge top, and about 300' east of a large ravine running south, at the intersection of fence running North-South and East-West. The said fence lines are not running in the cardinal directions and area skewed about 5° clockwise.	

PERPETUATION RECORD

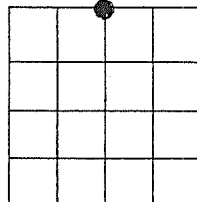Monument: Describe new monument set or work done to perpetuate/preserve the existing monument/position.							
1/4 corner between Section 17 and Section 20; A 0.6'x0.15' sandstone was found 1.5' above grade. This corner was measured from on the 1891 Legal Survey (Bk 2. pg 183-184) but the survey calls for the "North 1/2 mile post" and does not specifically call for a stone although this is most likely the monument that was being used. A tree had fallen upon and uprooted the stone. A 2 1/2 inch aluminum monument with a 3 1/4 inch cap was set to replace the stone. The stone was buried on the beside of the new monument.							
Corner Diagram		Accessories: Describe new BTs & witness objects established to perpetuate existing evidence.					
		4" Maple N45°W 12.9' 6" Maple N55°E 39.6' 9" Pignut Hickory S5°W 35.1'					
		Corner Recordation:		Certificate Prepared:			
		Filed and Recorded in County records:		Date:			
		Book:		Page:			
Section: 20		Geodetic Coordinates:		Lat./N.		Long./E.	
		Edited By:		BTR		Date Created: 10/2004	

Index: N-7

Corner: N ¼

LAND CORNER RECORD

State of Indiana
Hoosier National Forest

Twnshp: 7N

Range: 1E

Section: 20 2nd P.M.

County

Monroe

EXISTING SURVEYS

Original Government Survey

Original Survey Evidence Found

Year Surveyed:	1814	By:	Arthur Henrie	Date of Search:		By:		
Original Monument:	Wood post			Monument Found:				
Species	Diameter	Bearing	Distance	Species	Diameter	Bearing	Distance	
Hickory	4"	N 17°W	3 Lks.					
Ash	10"	S 61°E	13 Lks.					
Subsequent Corner Restoration				Evidence of Subsequent Corner Restoration Found				
Where Filed or Recorded:				Year Searched:	8/24/04	By:	B.Stone	
Book:				Page:	Date:	Monument Found	Rebar with aluminum cap stamped as shown set flush with the ground and small rock cairn partially around it. Set by Bledsoe,Tapp & Riggert Inc.	
Monument Set:								
Species	Diameter	Bearing	Distance	Species	Diameter	Bearing	Distance	

OTHER EVIDENCE

Describe corner loc. relative to nearby features & dir. to corner location; note fences, roads, etc.	Sketch of Monument
The monument is located on a steep east slope approximately 30 feet uphill from the head of a side drainage. A 21" diameter Scarlet Oak with 2 strands of barbwire in the center is S 17°W 15.2 feet. The ridgetop is approximately 60 feet west. Old fence remnants in trees and on the ground are running north and south. The timber is pole to sawlog size in all directions in an open forest. An aluminum survey marker post is set in the rock cairn 0.6 feet northeast from the monument.	

PERPETUATION RECORD

Monument: Describe new monument set or work done to perpetuate/preserve the existing monument/position.




Corner	Diagram	Accessories: Describe new BTs & witness objects established to perpetuate existing evidence.					
		Bearing trees are blazed, scribed, painted and have red bands but no tags: P. Hickory (w/wire) 10" S 13°W 36.0Ft. S. Maple 4" N 41°W 13.2 Ft. S. Maple 5" N 60°E 39.5 Ft.					
		Corner Recordation:		Certificate Prepared:			
		Filed and Recorded in County records:		Date:			
		Book:		Page:			
Section:	20	Geodetic Coordinates:		Lat./N.		Long./E.	
		Edited By:	Robert J. Stone	Date Created:	8/25/04		



T. 7N R. 15E Mer. N.F. 400000 County Montana State Montana
R Section Corner common to sections 17 20 and

EXISTING SURVEYS

Original Government Survey	Original Evidence Found
Year surveyed _____	Year of search _____ By _____
Original monument _____ (Wood post, stone, pile of stones, pipe, etc.)	Monument found _____
Bearing Trees	
Species <u>1 Ash</u>	Species _____
Diameter <u>10"</u>	Diameter _____
Bearing <u>N 17W S 61 E</u>	Bearing <u>172°</u>
Distance <u>3 1/2 13 1/2</u>	Distance _____
Original Bearing Trees Found	
Species _____	Species _____
Diameter _____	Diameter _____
Bearing _____	Bearing _____
Distance _____	Distance _____
Subsequent Corner Restoration	
Year surveyed _____ By _____	Year of search <u>1973</u> By <u>M. Baine & J. Proctor</u>
Where filed or recorded _____	<u>10-14 to sandstone 7" x 1 1/2" x 1 foot</u>
Monument _____ (Original, concrete post, iron rod, etc.)	<u>at 20 intersect rd & corner</u>
Evidence of Subsequent Corner Restoration Found	
Bearing Trees, Reference Objects	
Species _____	Species _____
Diameter _____	Diameter _____
Bearing _____	Bearing _____
Distance _____	Distance _____
Bearing Trees, Reference Objects	
Species _____	Species _____
Diameter _____	Diameter _____
Bearing _____	Bearing _____
Distance _____	Distance _____

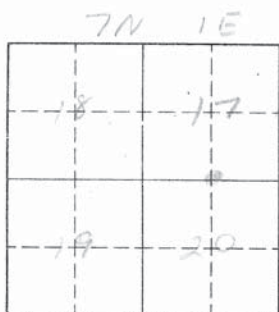

Sketch

○ Corner  F.S. Land

Relation of Evidence to Record Features Along Section Lines

Section line to sections				
Object				
Record distance				
Measured distance				

Other Evidence

Describe evidence of use and occupation such as roads, fences, clearings, timber cutting lines, plantations, etc.. Cite source of testimony if any. State

corner of 4 boxes however the fences were not in true N-S or E-W direction

At time of search:

1. Did you have the record description?

Yes ☒ No ☐

2. How was search area located?

Pacing, chaining, photos, maps,
etc. _____

3. Man hours spent in search 5 hrs

4. Do you think additional search might recover evidence? Yes _____ No _____

5. Signature S. Khan

Perpetuation Record

Monument and accessories established. Include brief description of area. _____

Certified corner restoration certificate prepared: Yes _____ No _____

Filed in county records at _____ Date _____ County Document No. _____

Identified on aerial photo No. _____ Which is filed at _____